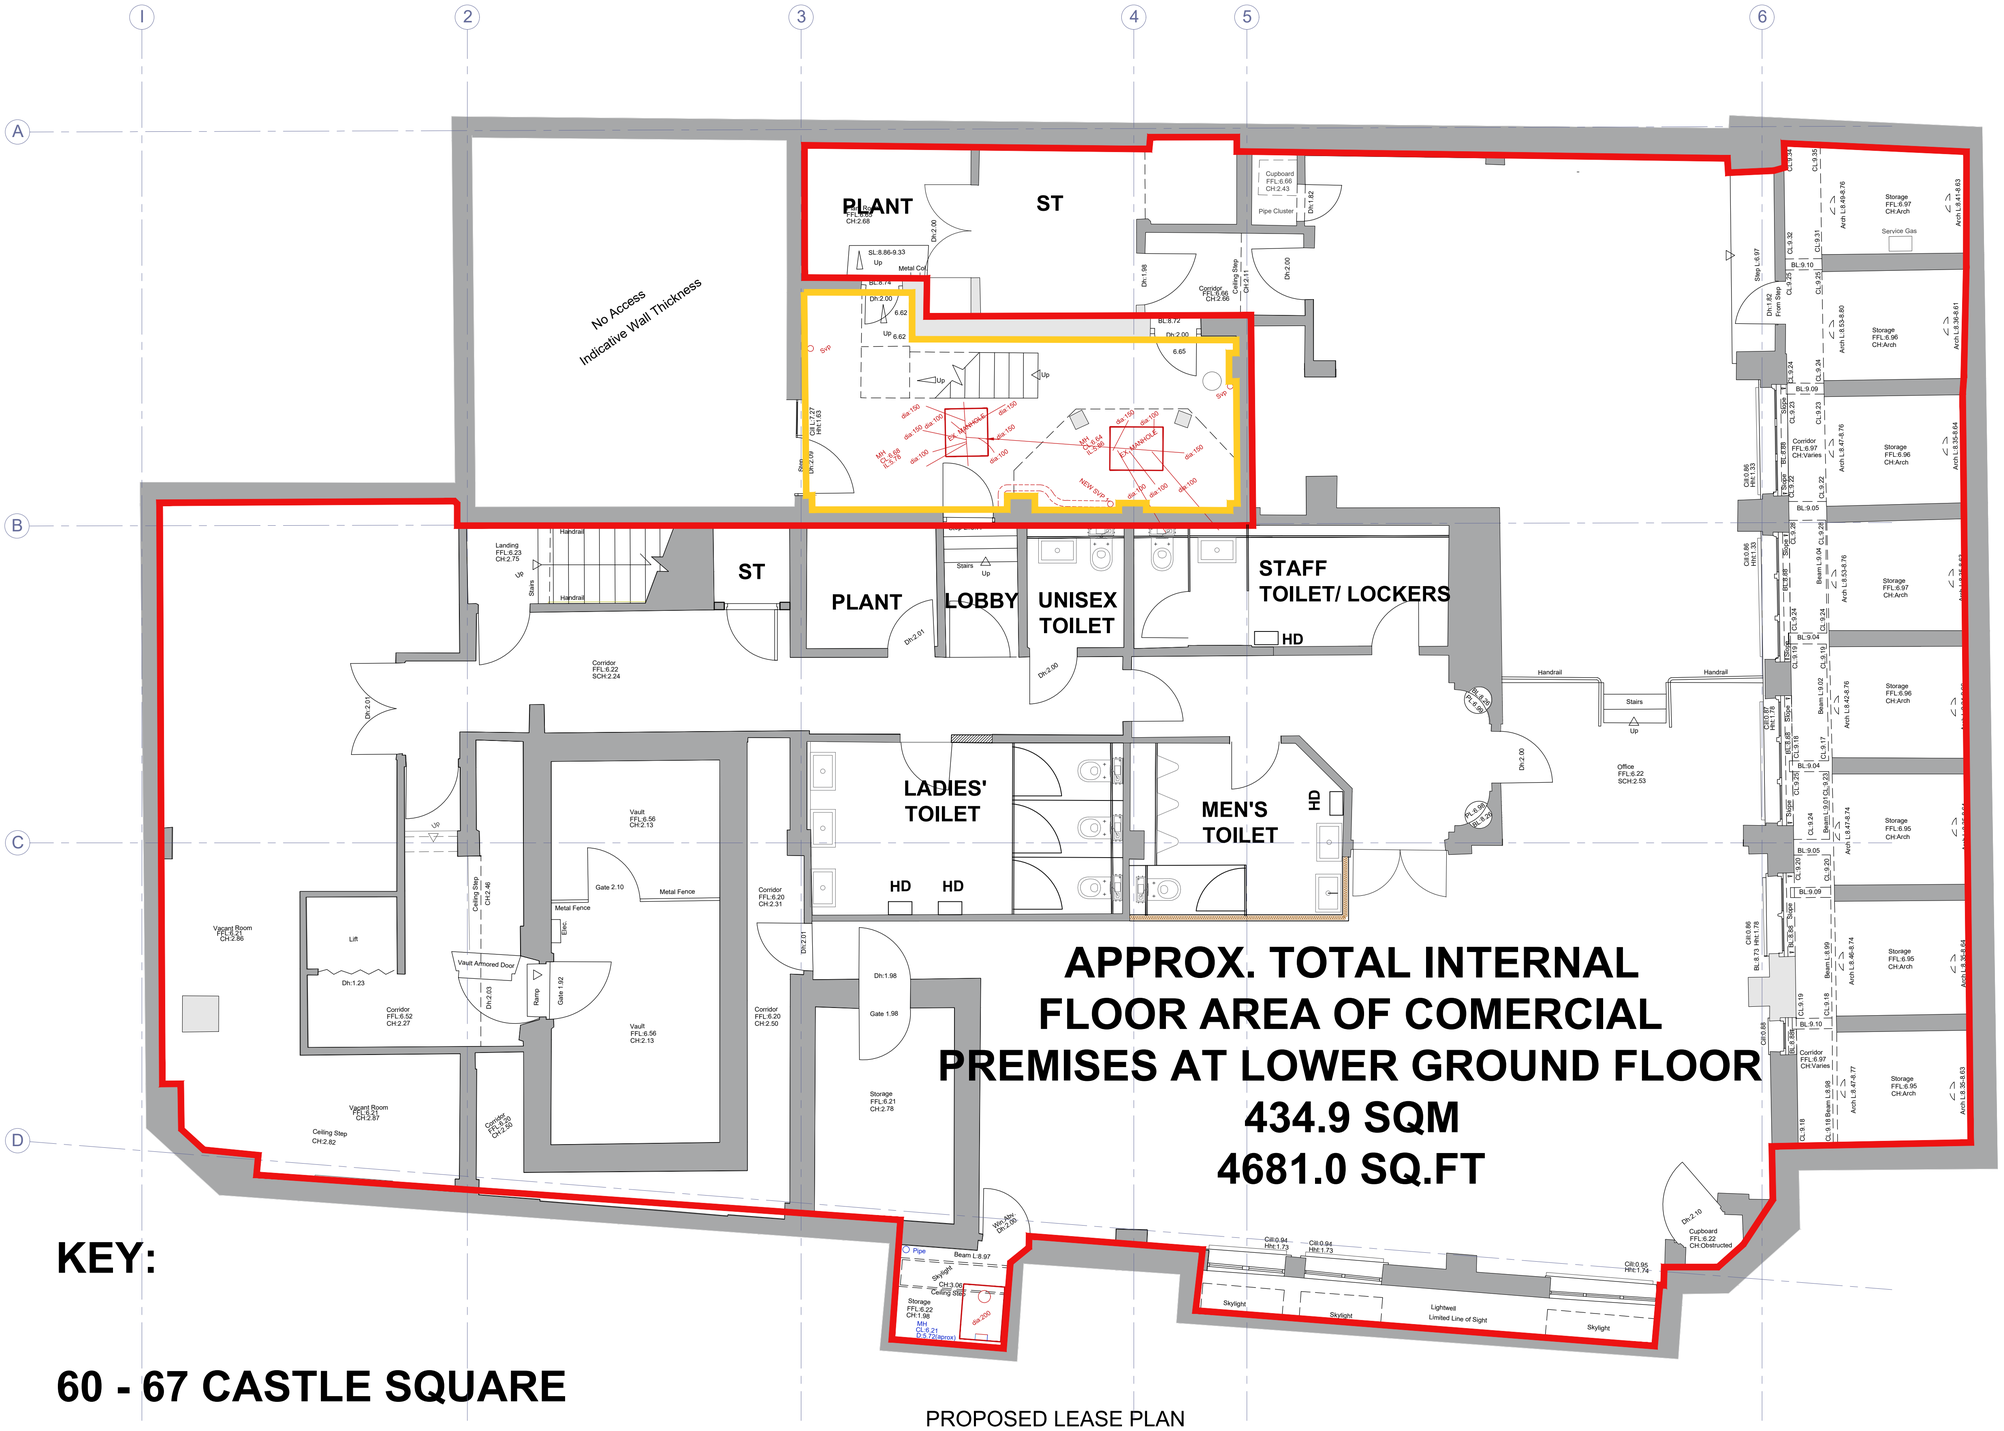

PLANT
ST
No Access
Indicative Wall Thickness
ST
PLANT
LOBBY
UNISEX TOILET
STAFF TOILET/ LOCKERS
HD
LADIES' TOILET
MEN'S TOILET
HD HD
HD
Corridor FFL:6.22 SCH:2.24
Vault FFL:6.56 CH:2.13
Vault FFL:6.56 CH:2.13
Corridor FFL:6.20 CH:2.31
Corridor FFL:6.20 CH:2.50
Storage FFL:6.21 CH:2.78
Corridor FFL:6.52 CH:2.27
Vacant Room FFL:6.51 CH:2.86
Vacant Room FFL:6.51 CH:2.87
Lift
Vault Armored Door
Ramp
Gate 2.10
Metal Fence
Gate 1.98
Gate 1.92
Ceiling Step CH:2.46
Ceiling Step CH:2.82
Corridor CH:2.59
Landing FFL:6.23 CH:2.75
Handrail
Stairs
Up
Dn:2.01
Dn:2.03
Dn:1.23
Dn:2.09
Dn:2.00
Dn:1.98
Dn:2.51
Dn:2.00
Dn:2.01
Dn:2.00
Dn:1.82
Dn:2.00
Dn:2.00
Dn:2.10
Cupboard FFL:6.66 CH:2.43
Pipe Cluster
Corridor FFL:6.66 CH:2.56
Ceiling Step CH:2.11
Step L:6.97
Dn:1.82 From Step
Office FFL:6.22 SCH:2.53
Cupboard FFL:6.22 CH:Obstructed
Storage FFL:6.97 CH:Arch
Service Gas
Storage FFL:6.96 CH:Arch
Storage FFL:6.95 CH:Arch
Corridor FFL:6.97 CH:Varies
Beam L:9.04
Beam L:9.01
Beam L:8.99
Beam L:8.98
Arch L:8.49-8.76
Arch L:8.41-8.63
Arch L:8.30-8.61
Arch L:8.19-8.40
Arch L:8.08-8.64
Arch L:8.53-8.76
Arch L:8.42-8.76
Arch L:8.47-8.74
Arch L:8.36-8.63
BL:9.10
BL:9.09
BL:9.05
BL:9.04
BL:9.00
Skylight
Lightwell
Limited Line of Sight
Cill:0.94 Hht:1.73
Cill:0.95 Hht:1.75
Cill:0.88 Hht:1.33
Cill:0.86 Hht:1.33
Cill:0.88 Hht:1.73
Cill:0.88 Hht:1.78
Cill:0.88 Hht:1.78
Cill:0.88 Hht:1.78